

Technical Advisory Bulletin (TAB)

Bulletin #: TBMELCO08A

July 29, 2015

Product: Melco EMT16, BRAVO

Implementation: ☐ Urgent ☐ Mandatory ☐ As Required ☒ Info Only

Reference: EC3329

Subject: Power Supply Shunt

SITUATION:

The power supply in the Melco EMT16 and BRAVO machines emits electrical noise into the electrical system of the machine. In some cases the noise level is significant enough that it can impact functionality of electronics, specifically the Thread Break Sensor, on the machine.

SOLUTION:

Melco implemented a shunt that connects certain terminals on the power supply, which reduces or eliminates the electrical noise transmitted from the power supply into the rest of the electrical system on the machine.

- The shunt Melco part number is 34737 and 34772 (Canada only).
- The power supply shunt was implemented on Melco EMT16 serial number 400954 and up and BRAVO serial number 340360326 and up.

RECOMMENDED ACTION:

- In case a technician is at a customer site for a Melco EMT16 (34400) or new BRAVO machine (34000-02) it is recommended that a shunt gets installed as per instructions below.
- No other corrective or preventive actions are necessary.

Shunt Installation:


1. Power down the machine and unplug it from the power source.
2. Remove the Lower Arm Rear Cover (34351 or 30526-04) from the machine.
3. Loosen but do not remove the terminal screws marked with “-V” and “ $\perp$ ” (see pictures below).
4. Slide the Shunt (34737 or 34772 for Canada only) over the “-V” and “ $\perp$ ” terminals. See pictures below.
5. Tighten the terminal screws.
6. Reassemble the Lower Arm Rear Cover.
7. Reconnect the machine to power and operate as normal.

Copyright © Melco International LLC, 2015

ALL RIGHTS RESERVED - Produced for communicating technical information to Melco service representatives and other authorized Melco technical personnel. Redistribution of this publication is prohibited without the prior written approval of Melco International LLC.

All precautions have been taken to avoid errors or misrepresentations of facts, equipment, or products. However, Melco International LLC does not assume any liability to any party for loss or damage caused by errors or omissions.

Shunt (34737) install

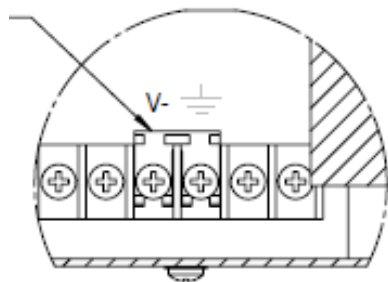

Shunt (34772) install – Canada only

